
WEXXAR BEL

Plastic Washer, Z29-061

Flat plastic washers placed between the wiper arms and the tape head side plate.

Written By: Wexxar WISE Admin

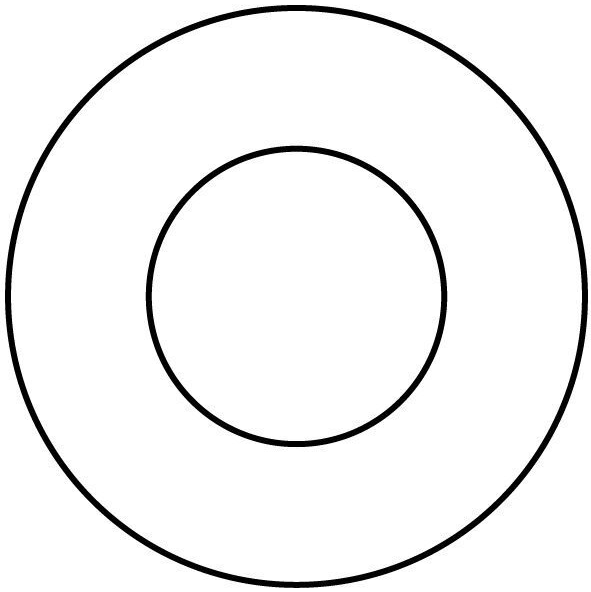

TOOLS:


- 5/32" Hex Key (1)
- 1/8" Hex Key (1)
- 3/32" Hex Key (1)
- 3/16" Hex Key (1)


PARTS:

- Z29-061 (2)

© 2024

Step 1 — Remove the Side Plate

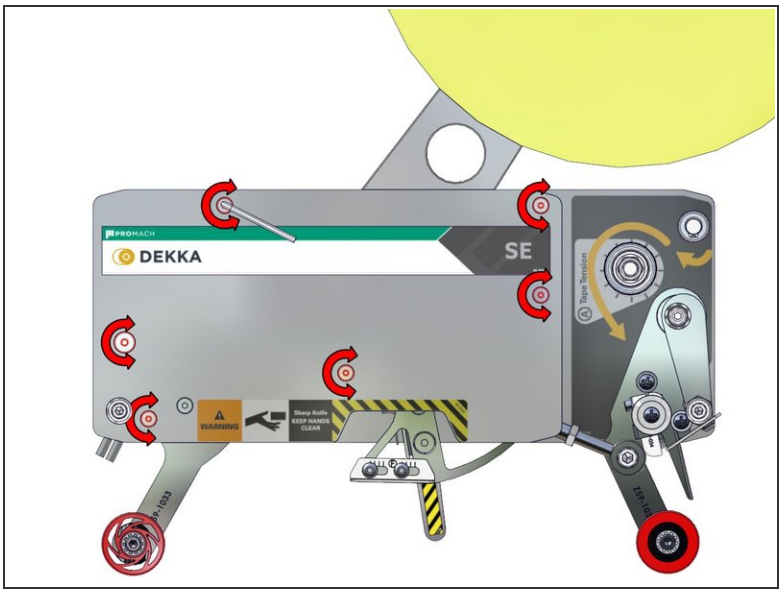


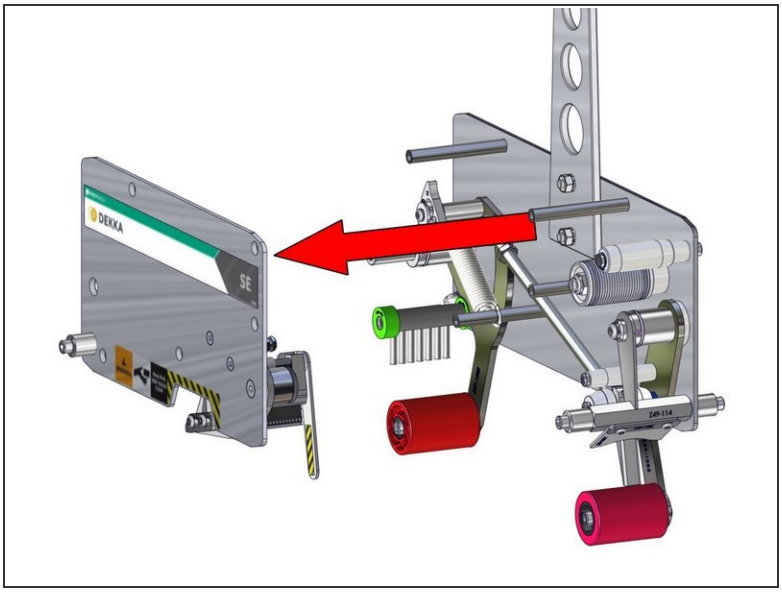

⚠ **Warning! Sharp Blade!**

- Using a 1/8” and 5/32” hex key, remove the six screws that secure the Side Plate.
- Remove the Side Plate.

Step 2 — Remove the Main Roller Tension Spring

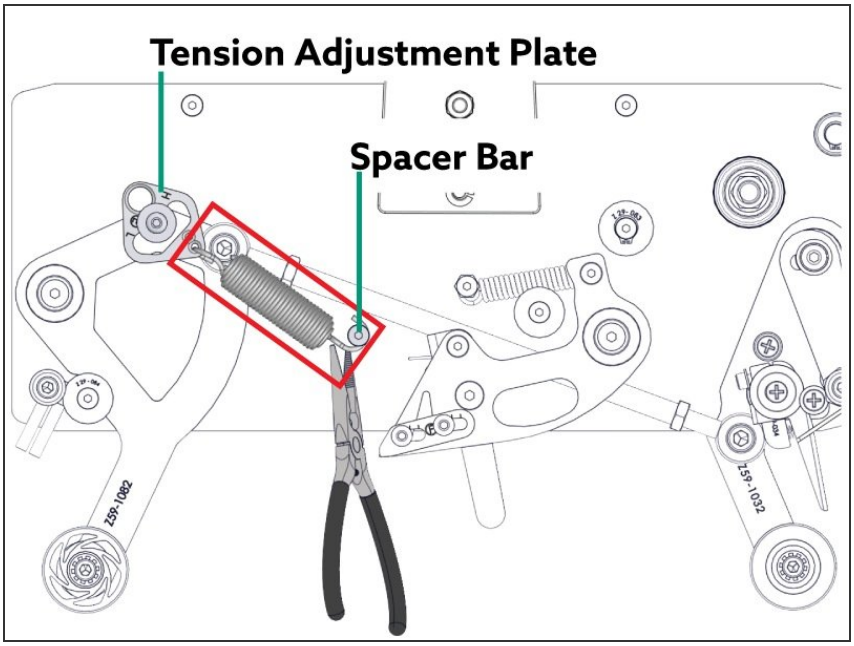


⚠ **Warning! Sharp Blade!**


⚠ **Keep Fingers Clear of Spring Pinch Points.**

- **Remove** the Main Roller Tension Spring using needle-nose pliers.

ⓘ The spring is hooked onto the Tension Adjustment Plate and Spacer Bar.


Step 3 — Remove the Front Mount Assembly

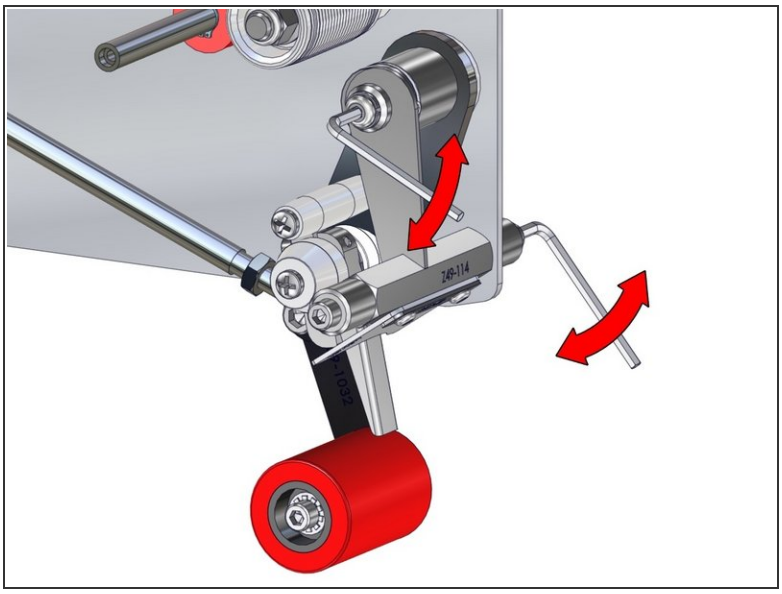

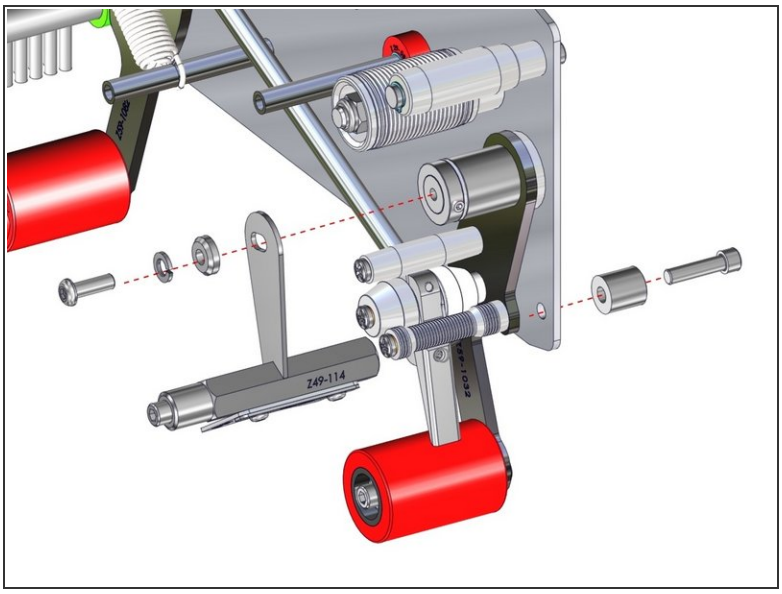


- Using a 3/16” hex key, remove the two screws that secure the Front Mount Assembly.
- Set aside components in a safe place.

Step 4 — Loosen the Locking Spacers

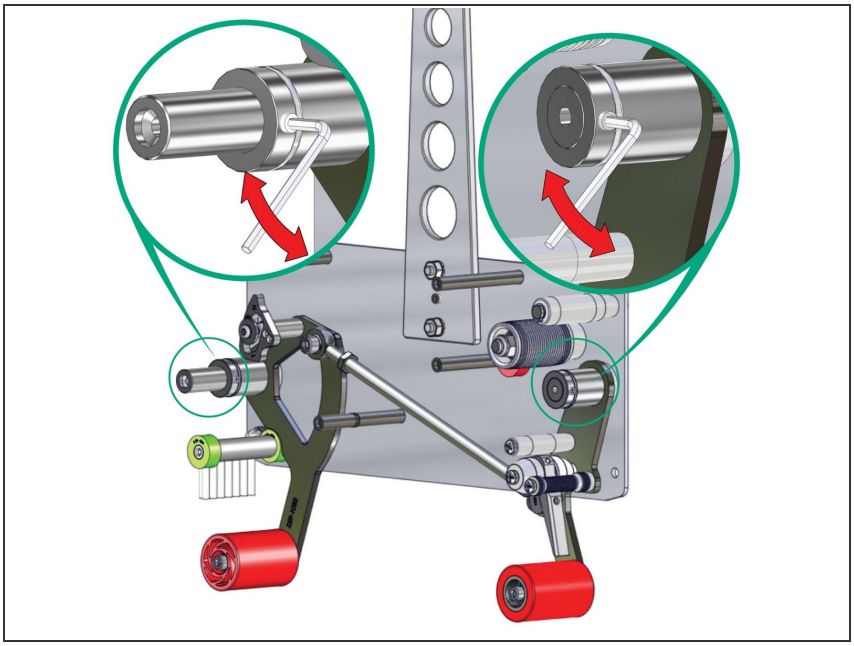


- Using a 3/32” hex key, **loosen** the set screw on the locking spacers.


Step 5 — Replace the Plastic Washers

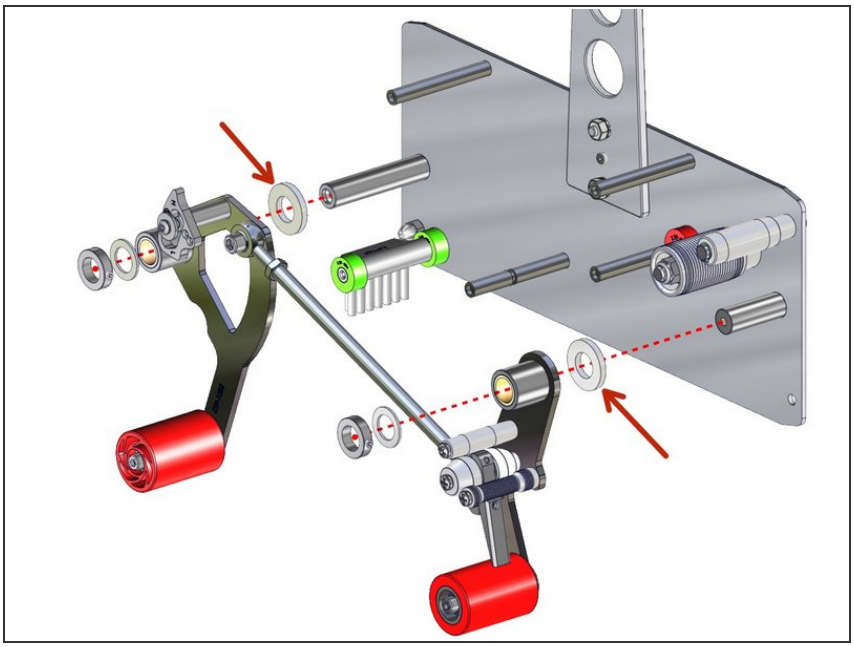

- Slide off the contact roller arms.
- Replace the Plastic Washer(s) as needed

Step 6 — Reassemble the Tape Head

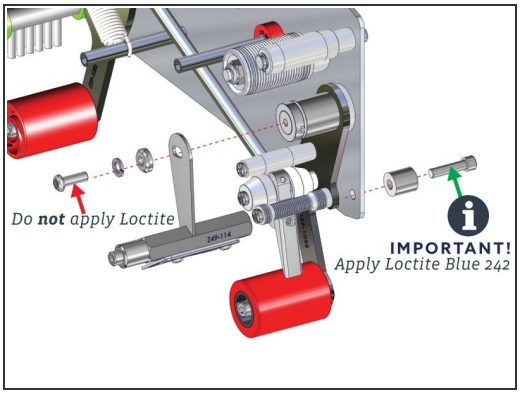

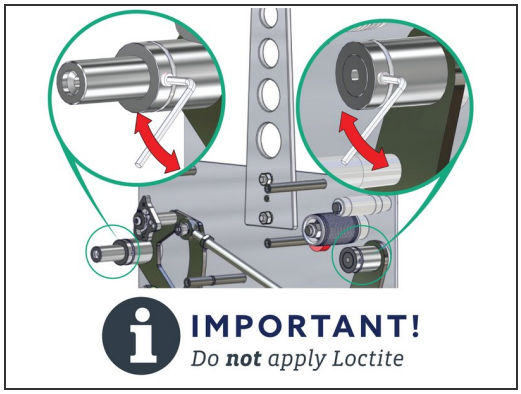



- Reverse steps to reassemble the tape head.

ⓘ **Only** apply Loctite Blue 242 on the Front Mount Assembly's exterior mounting screw and the Side Plate's screws.

⚠ Do **not** apply Loctite on other screws.

Thank you for contacting us. For us to better assist you, please reach out to our technical support by phone at 1.888.565.3219 or 604.930.9300 or by email at Wexxar.Service@promachbuilt.com or Wexxar.Parts@promachbuilt.com along with your machine model and serial number. One of our tech support reps will be glad to answer any questions you may have.